CE

KISTOCK DATALOGGER
HVAC range : KT110 / KH110

Temperature / Humidity / Light

KEY POINTS

- Up to16 000 measurement points
- Measure up to 3 parameters
- With or without external input
- 2 configurable setpoint alarms

- Fast data download (1000 values/second)
- Magnetic mounting
- IP40 housing

FEATURES OF HOUSING

Dimensions
98.7 x 67.8 x 34.7 mm

Weight
113 g

Display
1 line LCD screen
Dimension of screen : 45 x 17 mm

Control
2 keys : Select and OK

Material
Compatible with food industry environment
ABS housing
Sides and caps made of Elastomer

Protection
IP 40

PC communication
1 digital input

Digital electronics
Lacquer protected circuit board
Meets RoHS standards

Battery power supply
Type lithium 3.6 V ½ AA

Visual alarm
2 electroluminescent diodes(green and red)

Environment
Air and neutral gases

REFERENCES

Part number	Internal sensor	Display	External input number	Nb of recording points	Parameters
KT-110-IN	Yes	No	0	12 000	Temperature and Current/voltage
KT-110-IO	Yes	1 line	0	12 000	
KT-110-AN	Yes	No	1	16 000	
KT-110-AO	Yes	1 line	1	16 000	
KH-110-AN	Yes	No	0	16 000	Humidity, temperature and light
KH-110-AO	Yes	1 line	0	16 000	

TECHNICAL FEATURES

	KT110	KH110
Units displayed	°C, °F, mV, V, mA, A	°C, °F, %RH, °Ctd, Lux*, °Ftd
Resolution	0.1 °C, 0.1 °F, 0.001 V, 0.001 mA, 0.1 A	0.1 °C, 0.1 °F, 0.1%RH, 1 Lux*
External inputs	1 Jack connector 2.5 stereo	
Internal sensor	Temperature	Humidity, temperature, light
Setpoint alarms	2 setpoint alarms on each channel	
Frequency of measurement	From 1 s to 24 h	
Working temperature	From -40 to +70 °C	
Storage temperature	From -40 to +85 °C	From -20 to +70 °C
Battery life**	5 years	

Brightness data are recorded, the screen does not display them.

** on the basis of 1 measurement each 15 minutes at 20°C

• TEMPERATURE PROBE (OPTIONAL)

Type of sensor	NTC
Measuring range	From -40 to +120 °C (remote probe)
Accuracy*	±0.3 °C (-25 °C<T<+70 °C) ±0.5 °C (beyond)

• INTERNAL SENSOR

Type of sensor	NTC
Measuring range	From -40 to +70 °C
Accuracy*	±0.4 °C (-20 °C<T<+70 °C) ±0.8 °C (beyond)

• CURRENT INPUT CABLE (OPTIONAL)

Measuring range	0/4-20 mA
Accuracy*	±0.2 % of the measurement ±1 µA

• VOLTAGE INPUT CABLE (OPTIONAL)

Measuring range	0-10 V
Accuracy*	±0.2 % of the measurement ±1 mV

• AMMETER CLAMP (OPTIONAL)

Measuring range	0-50 A / 0-100 A / 0-200 A / 0-600 A
Accuracy*	±1 to 2.5 % of the value displayed (according to measuring range)

See technical datasheet "Measuring probe and cable for class 110/210 kistock dataloggers"

TECHNICAL FEATURES FOR INTERNAL SENSOR   KH110

• THERMO-HYGROMETRY

|	Hygrometry	Temperature
Type of sensor	CMOS	
Measuring range	From 5 to 95 %RH	From -20 to +70 °C
Accuracy*	**Accuracy** (Repeatability, linearity, hysteresis) :** ±2%RH (from 15°C to 25°C) **Factory calibration . uncertainty :** ±0,88 %RH **Temperature dependence :** ±0.04 x (T-20) %RH (if T<15°C or T>25°C)	**From -20 to 0°C :** 2% of displayed value ±0,6 °C **From 0 to 30 °C :** 0,5 °C **From 30 to 70 °C :** 1.5% of displayed value
Response time ($t_{0.63}$)	50 s (Vair = 2 m/s)	25 s (V = 2 m/s)

• LIGHT SENSOR

Type of sensor	Photodiode
Measuring range	From 0 to 10 000 Lux
Accuracy*	±10 %

All accuracies indicated in this document were stated in laboratory conditions and can be guaranteed for measurements carried out in the same conditions, or carried out with calibration compensation.
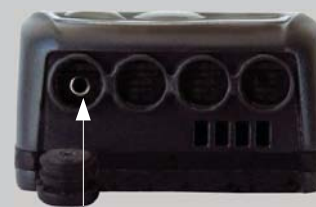
**As per NFX 15-113 standard and the charter 2000/2001 Hygrometers, GAL (Guaranteed Accuracy Limit) which has been calculated with a coverage factor value of 2 is ±2,88%RH between 18 and 28°C on the measuring range from 5 to 95%RH. Sensor drift is less than 1%RH/year.*

DIMENSIONS (mm)

34.7   67.85   98.7
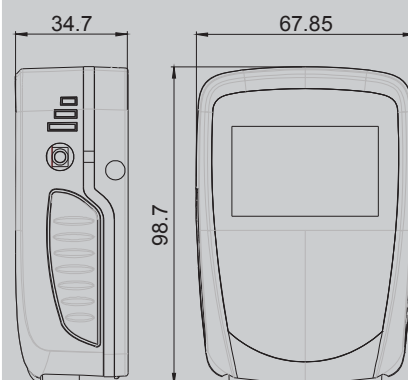
CONNECTIONS

External input (KT 110-A)

Jack connectors (2.5)
Probes inputs for :
- NTC temperature
- Current input cable
- Voltage input cable
- Ammeter clamp

PC connection input

Jack connector (3.5)
Input for Kistock-PC software

5 recording modes

KISTOCK can record in 5 different ways :
• **"Immediate"** mode records values according a predefined interval.
• **"Minimum"**, **"Maximum"** and **"Average"** record automatically the calculation of minimum, maximum or average of measured values during an interval of recording.
• **"Monitoring"** mode allows to get an accurate history report during error events to help troubleshooting, without stopping the measurement logging. To proceed this way, you just have to define :
  - a record interval to be used whilst the readings are beyond the setpoints.
  - a record interval for the values measured during each reading beyond the setpoints..
Furthermore, you can also let your KISTOCK record non-stop (**"loop"** recording option).

4 types dataset start

Once your recording mode has been set, you can launch your dataset :
• With a delayed start (with predefined date and time)
• With the software
• With push-button
• With **"Online"** option. In this case, your datasets are directly sent, saved and displayed on your PC in real time.

6 types of dataset stop

You can stop your dataset :
• According to a date and time (if it was started the same way)
• According to a period
• According to a predefined number of recording points
• Once the storage capacity is full
• With **"Stop"** option of the software
• By holding "OK" key for at least 5s, if this function has been previously activated by the software.

SCREEN

END — DATASET is finished

REC — One value is being recorded

LOG — *Flashing : dataset has not started yet*
Constant : data set is in progress

FULL — *Slow flashing : dataset is taking 80-90% of storage capacity*
Fast flashing : dataset is taking 90-100% of storage capacity
Constant : storage capacity filled up

1 2 — *Channel No, which is measuring*

ACT — *Refresh of displayed measurements*

TIME — *Display of measurement and recording intervals*

Status of battery life : 5 levels (4 blocks + empty battery)
Flashes when only one block is remaining

MIN / **MAX** — *Displayed values correspond to maximum and minimum values of the channels*

Alarm action type : rising or falling action

°C…Temperature in degrees Celsius
°F...Temperature in degrees Fahrenheit
%RH..........Relative humidity (KH 110)
td...Dew point temperature (KH 110)
V or mV Voltage expressed in V or mV (KT 110)
A or mA Current expressed in A or mA (KT 110)

bAt — *flashing on the screen + flashing of LEDs : means that battery must be changed*

Err — *+ flashing of the green LED : detection of communication error* → *Press **"Select"** and **"OK"** keys to reset the instrument*

Err — *+ flashing of the red LED : detection of measurement error* → *Press **"Select"** and **"OK"** keys to reset the instrument*

SOFTWARE

• Configuration and data processing software
KILOG software enables you to configure, save and process your data in a very simple way.
- Software..*Ref. KILOG-N*
- USB interface...*Ref. I-KIC2*
- Complete set : soft + 1 interface...............*Ref. KIC2 KILOG*

• KISTOCK-PC interface K
This USB cable enables you to connect your KISTOCK to your PC.
Ref. I-KIC2

• KILOG CFR software
KILOG CFR software is the key tool for users who requires traceability, in accordance with 21CFR-Part11 standards. Security and integrity of data are guaranteed : it is not possible to modify or tamper with the data.

- Interface...*Ref. I-KIC2*
- Complete set : KILOG 1CFR software + 1 interface.*Ref. KIC2-CFR-N*

NOTE Software is compatible with the former range of Kistock.

ACCESSORIES

• KNT data collector
KNT data collector allows you to collect measurements from one or several KISTOCK directly on-site (up to 500,000 values stored). Data can be displayed and printed from the KNT or download to your PC.
Ref. KNT 300

• Printer for KNT 300 data collector
Ref. ITP

• Secured wall-mounting bracket
KIMO has designed a new proprietary anti-theft system with no padlock. Your system cannot be unlock or damaged : your installation is fully secured.
Ref. KAV-N

Once your KISTOCK is set on the mounting plate, insert the key to lock the mounting system.

To unlock : insert the key inside the metallic axis, and make ¼ turn.

Remove the key to release the metallic axis. Your KISTOCK is now unlocked.

• Wire extensions for NTC temperature probe.
Made of PVC HT, 5m long, with Jack connectors (male and female)
Ref. KRC 5
Note : you can connect several extensions together (maximum length 25m)

• Lace. *Ref. KDC*

• Lithium ½ AA battery. *Ref. KBL*

MOUNTING

KISTOCK can be mounted in different ways ; you can also move it or install it very easily.
- Magnetic mounting or wallmounting (see photos)
- Secured mounting (optional, see accessories)

Wallmount and lace eyelet

Magnetic mounting

HOW TO CHANGE THE BATTERY

With 5-year battery life*, KISTOCK guarantee long-term measurements.
To change battery :
- Remove the screw located at the back, with a screw driver.
- Remove the front part, along with the old battery.
- Insert the new battery observing the proper polarity
- Replace the front.
- Tighten the screw.
- **Press "SELECT" and "OK" keys for 2 seconds to refresh battery level.**
* on the basis of 1 measurement each 15 minutes at 20°C

CALIBRATION (Optional)

KISTOCK dataloggers can be supplied with calibration certificate as an option.

WARRANTY PERIOD

KISTOCK dataloggers have 1-year guarantee for any manufacturing defect (return to our After-Sales Service required).

www.kimo.fr

AFAQ
ISO 9001

EXPORT DEPARTMENT
Tel : + 33. 1. 60. 06. 69. 25 - Fax : + 33. 1. 60. 06. 69. 29
e-mail : export@kimo.fr

Distributed by :

PRC Technologies Corp., Ltd.
Tel: 02 530 1714, 02 530 1619, 02 530 1621
Fax: 02 530 1731
Email: info@prctechth.com, www.prctechth.com